280 mm

210 mm

INSTALLATION MANUAL
GEN II /LED Linear Light

IMPORTANT SAFETY INSTRUCTION

Read this installation guide prior to attempting installation. Always turn OFF the main power before starting your installation. Consult a qualified electrician before installation. Installation should be carried out by a qualified eletrician.

During installation,basic safety precautions should always be followed, including the following listed.

1. Do not install the lighting system in a wet location.
2. Ensure the appropriate connectors match the luminaire fixture
3. Do not install any part of the luminaire less than 5 feet above the floor.
4. Do not install any luminaire assembly closer than 5 inches from any window treatments,i.e.,curtain, blinds or any similar combustible type material.
5. Do not attempt to energize anything other than the luminaire fixtures.
6. To reduce the risk of fire and electric shock,do not attempt to connect to power tools, extension cords, appliances, or the like, to the track.
7. maintenance of the luminaires should be performed by person(s) familiar with the luminaires construction and any hazards involved. regular fixture maintenance programs are recommended.
8. Do not exceed the nominal supply voltage or amperage ratings.
9. Turn the power OFF at the fuse or circuit breaker box before doing any installation or maintenance activities.
10. Wear rubber soled shoes and work on a sturdy wooden or non-conductive ladder.
11. The lighting product must be mounted in locations and at heights in compliance with the National Electrical Code and with local building codes. Installing contrary to instruction may cause unsafe conditions.
12. To avoid hazards to children, take accountability for all parts and dispose all packing materials properly.
13. It may be necessary to clean the refractor / lens. Frequency of cleaning will depend on ambient dirt level and minimum light output which is acceptable to the user. Refractor / lens should be washed in a solution of warm water and any mild, non-abrasive household detergent, rinsed with clean water and wiped dry. Should optical assembly become dirty on the inside, wipe refractor / lens and clean in above manner, replacing damaged gaskets as necessary.
14. Call the Technical Support department about any installation questions.
15. Do not install a damaged product. This luminaire has been properly packed so that no parts should have been damaged during transit. Inspect to confirm. Any part damaged or broken during or after assembly should be replaced.
16. These instructions do no purpose to cover all details or variations in equipment nor to provide every possible contingency to meet in connection with installation, operation or maintenance.Should further information be desired or particular problems arise,not covered sufficiently for the purchaser's or owner's purposes, please contact the Technical Team.


⚠ CAUTION

This equipment is intended to be installed only by qualified personnel. The installation must be made in accordance with the current edition of the National Electrical Code (NEC) and all applicable state and local building codes. The final installation must be approved by the appropriate, qualified electrical / building inspector(s). Improper installation may result in a fire or electrical hazard. Ensure the electrical power to the circuit has been disconnected before installing the electrical system .

⚠ WARNING

- Risk of fire. Most dwellings built before 1985 have supply wire rated at 60℃.
- Consult a qualified electrician before installation.
- Properly ground electrical enclosure.
- To prevent wiring damage or abrasion, do not expose wiring to edges of sheet meal or other sharp objects.
- Use only UL approved wire input/output connections. Minimum size 18 AWG or 14AWG if there are any continuous runs.
- If the fixtures are connected in a continuous run, do not exceed allowable number of fixtures in series/power in continuous runs.
- Inrush currents must be taken in account by the electricians to account for proper circuit design.

TOOL

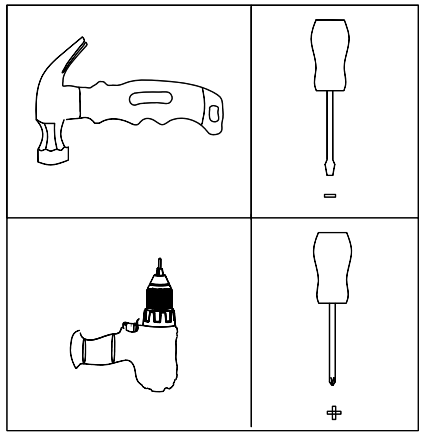

CONTENTS


A . Aircraft Suspension Mount ····· 2
B . Canopy Suspension Installation ····· 2
C . Linkable Instruction ····· 3
D . Wall Mount (Type-C) ····· 4
E . Surface Mount ····· 5
F . T-grid Recessed Mount with Frange ····· 5
G . Frange Recessed Mount with Clips ····· 6
H . Function ····· 6
I . E-Series ····· 7
J . Install The Sensor ····· 7
K . Change PC Lens with Parabolic Lens ····· 8
L . Link Pattern ····· 8
M . Drop Ceiling Suspension Moumt ····· 9
N . SDS:Drywall Suspension Kits ····· 9
O . Drywall Suspenion mount (Type-B) ····· 10
P . Metal non-luminous L/T/X ConnectorInstallation Instruction ··· 10
Q . Louver Installation Instruction ···· 10
R . Dry Ceiling Wall Recessed ···· 11
S . New T-bar recessed ···· 11
T . Install MAS &Sensor ···· 12

注：印刷时红色外框虚线与标注不印刷。


280 mm

210 mm


A . Aircraft Suspension Mount

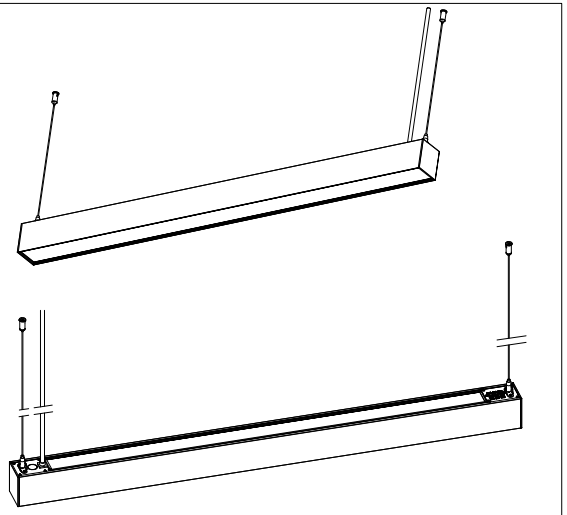

Installation Kits

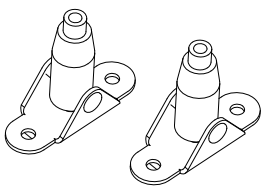


Steel wire rope pedestal 2pcs




PM4*8 Screw 4pcs




Plastic Anchor 2pcs

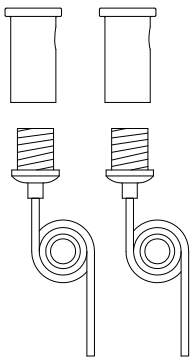




PA4*30 Screw 2pcs

Steel wire rope 2pcs

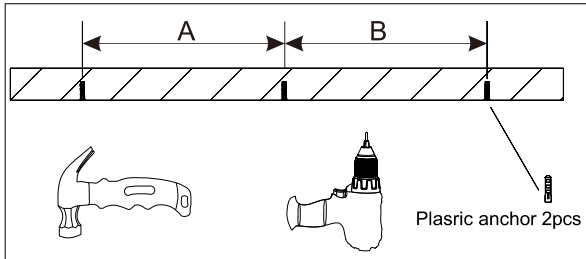


No.	Size	A(in)	B(in)
1	2FT	22.205	/
2	4FT	45.827	/
3	6FT	69.449	/
4	8FT	46.535	46.535


1.Drill a hole of 5.0mm in diameter at the location required for installation. Then install the plastic anchor to the hole with hammer.

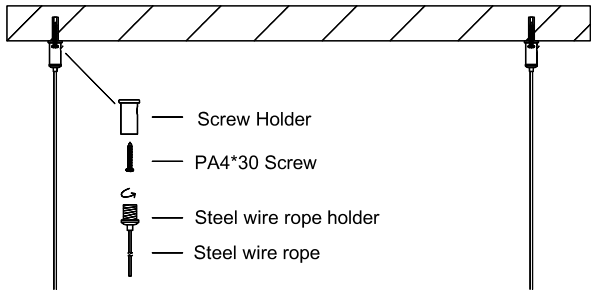


2.Insert PA4*30 Screws into the screw holder and then drill into the plastic anchor.

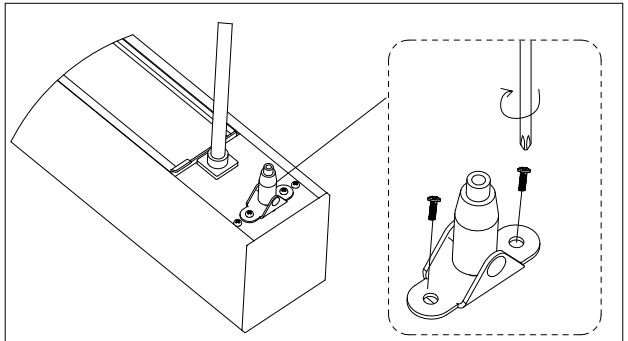


3.Lock the steel wire rope pedestal to the ends plates with PM4*8 screws.

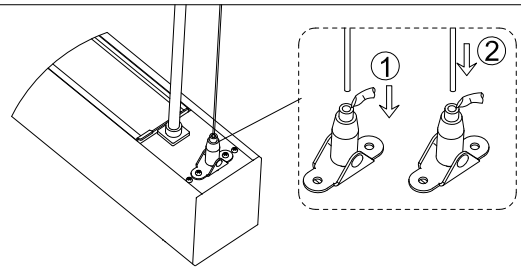

4.Press down the inner hole of the steel wire rope pedestal, let the steel wire rope go through the hole.

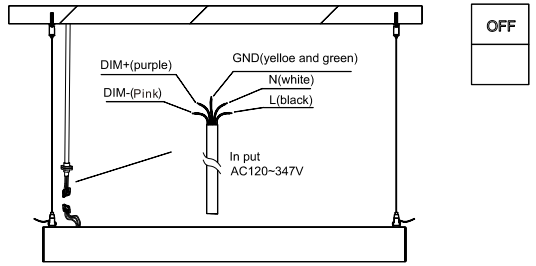


5.Connect L,N,GND,DIM+ and DIM- of AC input wire to L,N,GND,DIM+and DIM- respectively of AC terminal.

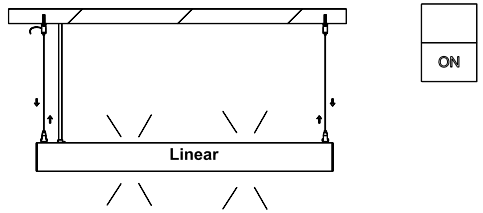


6.Press the to pend of the steel wire rope pedestal to adjust the steel wire rope,and then finish the installation.

B . Canopy Suspension Installation

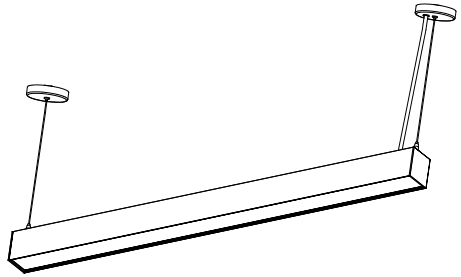


注：印刷时红色外框虚线与标注不印刷。

280 mm
210 mm




N0.	Size	A(in)	B(in)	C(in)	D(in)	E(in)
1	2ft	3.346	18.858	3.346	/	/
2	4ft	3.346	42.480	3.346	/	/
3	6ft	3.346	66.102	3.346	/	/
4	8ft	3.346	43.189	3.346	43.189	3.346


1. Drill a hole of 5.0mm in diameter as shown in the figure at the location required for installation. Then hammer the plastic anchor into the hole.

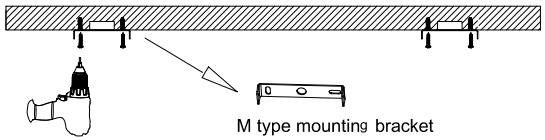

2. Insert PA4*30 screws into the M type mounting bracket and then drill into the plastic anchor.

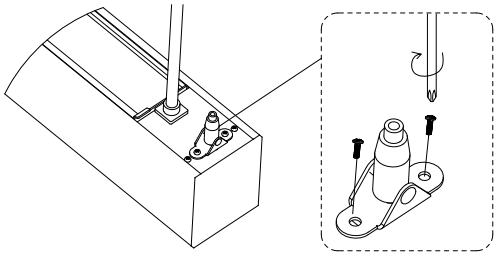



3.Lock the steel wire rope pedestal to the ends plates with PM4*8 Screws.

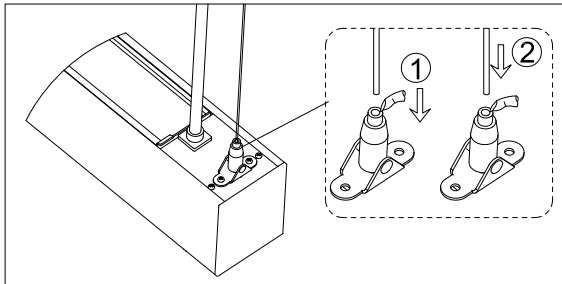

4.Press down the inner hole of the steel wire rope pedestal, let the steel wire rope go through the hole.


5.The thread locker passes through the canopy and is fixed with a screw nut, and the waterproof connector passes through the gasket and the canopy, and is fixed with a screw nut

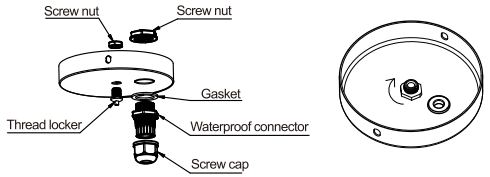





6. Press the steel wire rope holder as shown in the figure, and then insert the stainless steel wire into the inner hole of the steel wire rope holder; The mounting height of the lamp could be adjusted by this steel wire rope holder.

7.Pass the AC into the waterproof connector, fix the AC wire with a screw cap, connect the L pole to the black wire, the N pole to the white wire, the GND to the green wire, the DIM+ pole to the purple wire, and the DIM- pole to the pink wire

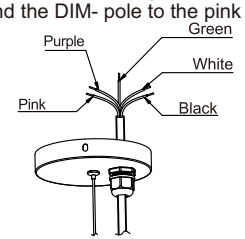

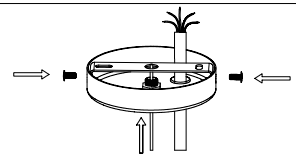

8. Adjust the length of the AC input cable, align the side hole of the canopy and the M mounting bracket as shown in the figure, then tighten the screw.

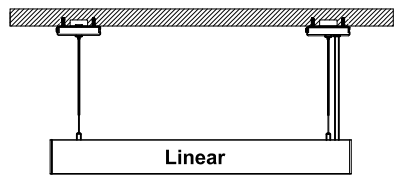


9. The installation is completed.

C. Linkable Instruction


Note:Only available for Linkable Products.

① Measure the ceiling , make down the position for lineae1, install the first Linear Light to the ceiling as instruction of A Rope Suspension Installation.

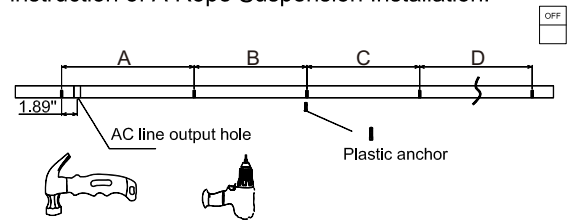


No.	Size	A(in)	B(in)	C(in)	D(in)	Remark
1	2FT	22.920	23.630	22.920	/	3pcs linkable diagrammatic drawing
2	4FT	46.540	47.250	46.540	/	3pcs linkable diagrammatic drawing
3	6FT	70.160	70.870	70.160	/	3pcs linkable diagrammatic drawing
4	8FT	46.540	47.250	47.250	46.540	2pcs linkable diagrammatic drawing


② Install Linear 1, then connect AC line; remove one end cap as show on (2-a-b)

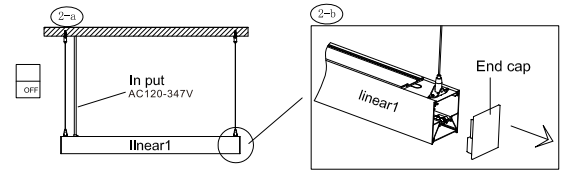

2-c Lift up the up-light module as the picture shows.

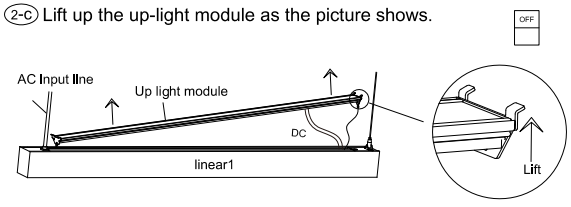

2-d Insert the linkable bracket into the Linear1,connect with buckle inside the Linear1,take out the inside linkable wire.（Five color）

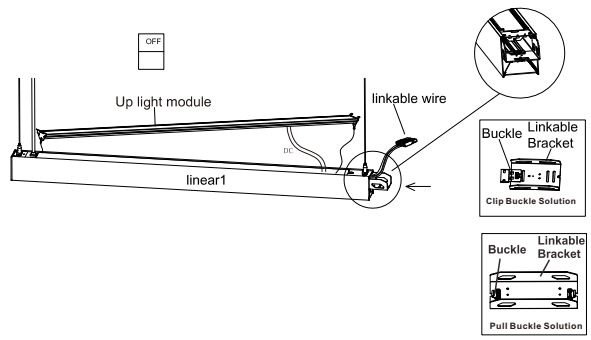


注：印刷时红色外框虚线与标注不印刷。


280 mm

210 mm


③Insert the Linear Light as Step 2 and adjust the steel wire rope in the same height. Then Move out two end caps of Linear2,lift up the up light module, disconnect the AC wire. keep the female plug to the side ends

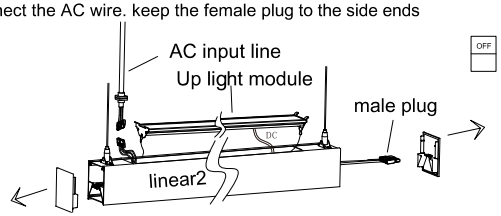


④Connect the male plug of Linear 1 and female plug of Linear2,insert the bracket to the Linear 2 make them seamless linkable together.

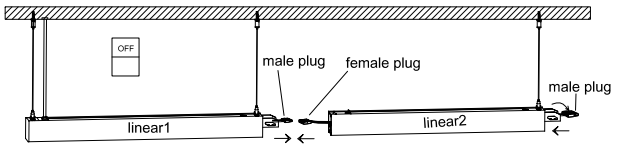


⑤ Check the status after linked make sure no any gap between two linears.

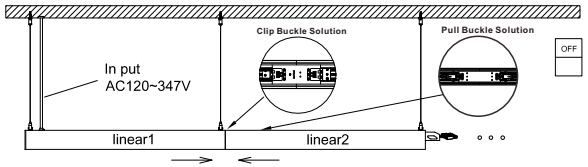

⑥ Make sure the male and female plugs have been connected well,press down the up light module, put it back to the top of Linear1 and Linear2

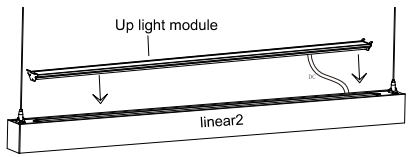


⑦ Install the Linear Light 3,4,5,6 and7 as above method,keep one main input cord on one side for wiring andg rounding Adjust the steel wrie rope inthe same height.Then finish the installation.

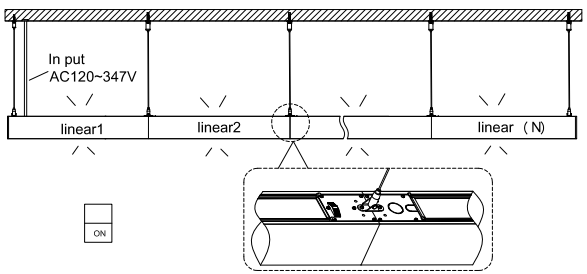


NOTE:
LED LINEAR CAN BE GAPLESS LINKABLE TOGETHER AS NEEDED,
(if you order to use 18# cord,More Links can be Customized.)

Link Instruction and Disclaimer

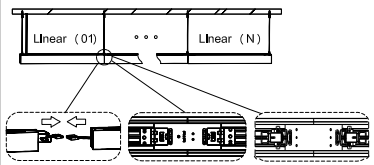


Max. linkable Quantity （Unit:PC)
Linkable fixtures Qty need to meet the below two conditions:
1) N≤7pcs
2) Input voltage = 120V , N*P≤420W
Input voltage = 277V , N*P≤960W
Input voltage = 347V, N*P≤1200W
Note: N = Qty of linkable fixtures,
P = Wattage per fixture


D. Wall Mount (Type-C)

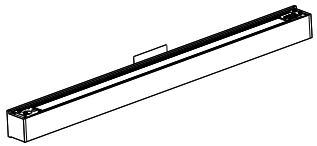

Installation Kits

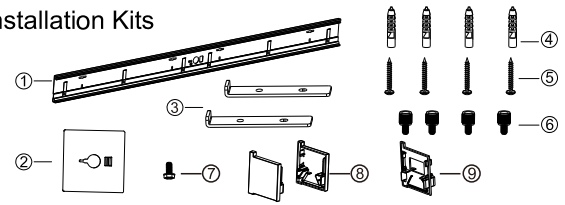



1	C Wall-mount Bracket	1PC
2	Square Decorative	1PC
3	L support	2PCS
4	Plastic Anchor	4PCS
5	Cross head tapping	4PCS
6	Hand screw	4PCS
7	Screw	1PC
8	End cap	2PCS
9	Linkable braket	1PC

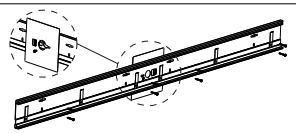


1. Drill Hole on the wall based on the Length of the Fixture, Fix the plastic anchor in the hole and fix the Wall Mount Bracket on the Wall.

2. Push the L support bracket into the wall mount bracket as followed.

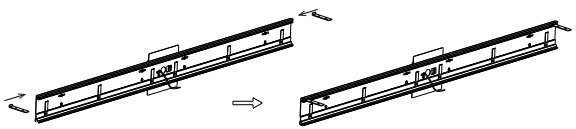

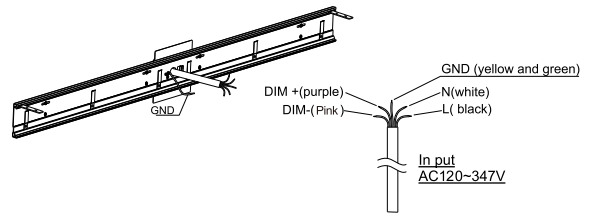


3. Connect L, N, GND, DIM+ and DIM- of AC input wire to L, N, GND, DIM+ and DIM- respectively of AC wire.

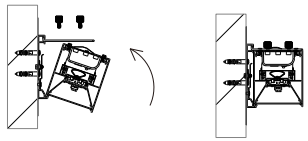


4. Get the linear light install into the wall mount bracket as followed picture. Using the hand screw to secure the linear light.

Connect the quick connector between the linear light and connector from the AC power wire. After then, put it into the linear body.

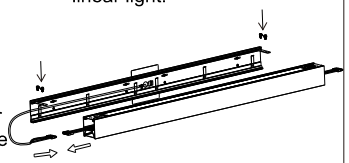


Linkable fixtures Qty need to meet the below two conditions:
1)N≤7pcs
2)Input voltage = 120V , N*P≤420W
Input voltage = 277V , N*P≤960W
Input voltage = 347V, N*P≤1200W
Note: N = Qty of linkable fixtures,
P = Wattage per fixture

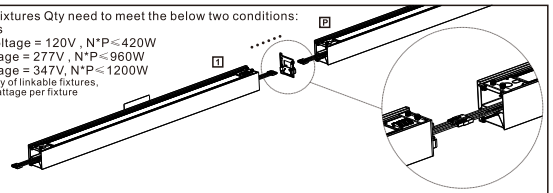


5. Linkable braket insert into one fixture , connect the male and female connector, the other part of linkable braket insert into the other fixuture. Then the fixture fixed on the wall mounted kit .

6. Install the end caps, the connector wire must get through the correct place on the end caps as followed picture.

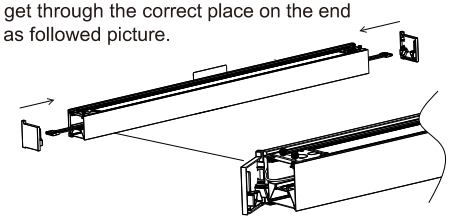

7. Turn on the light.




注：印刷时红色外框虚线与标注不印刷。


280 mm

210 mm


E . Surface Mount

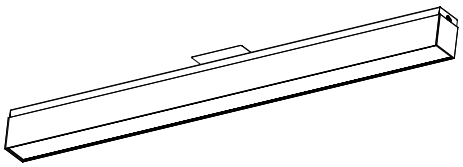


Installation Kits

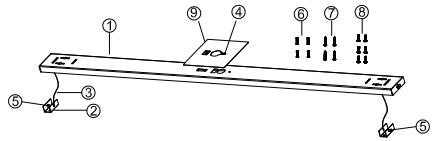

1	Surface Mount Bracket	1199*69*20mm
2	Surface Mount Bracket 2	43*22.5*18mm
3	Safety cable	L=150mm
4	Round head pull nail	4*5mm
5	Countersunk head screw	PM4*10
6	Cross head tapping screw	PA4*35M
7	Plastic Anchor	4*28mm
8	Round head machine screws	PM4*8mm
9	Decorative plate	140*140mm T=0.6mm

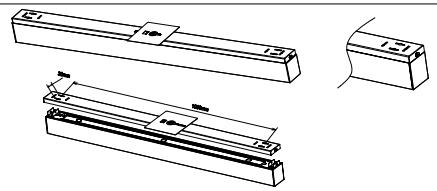


1.Drill Hole on the ceiling based on the Length of the fixture, fix the plastic anchor in the hole .

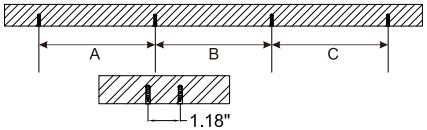


No.	Size	A(in)	B(in)	C(in)
1	2FT	18.898	/	/
2	4FT	42.520	/	/
3	6FT	25.984	14.173	25.984
4	8FT	37.795	14.173	37.795


2.Fix the surface mount bracket on the ceiling with PA4*30 screw.

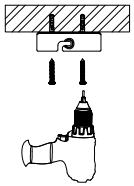


3.Hook the safety cable of the fixture on the slot of the surface mount bracket.

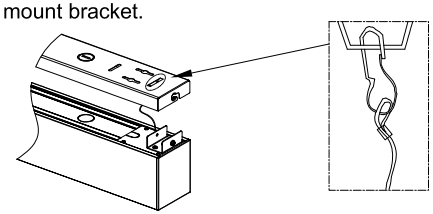


4.Wiring the fixture with the supply power, clear up the wires and safety cables, clip the fixture into the slot of the surface mount plate on two side

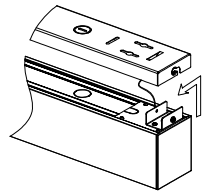

5. Fix screws on two side of the fixture

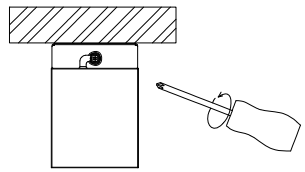


6. Turn on the light.

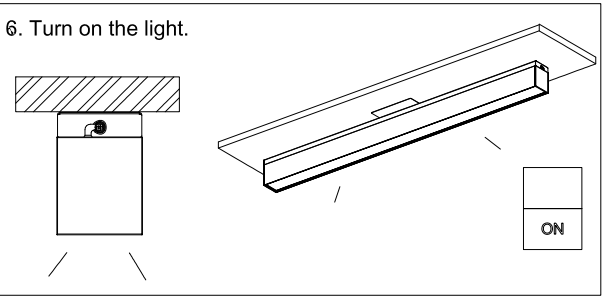


F . T-grid Recessed Mount with Frange


1.Adjust the position of T-bar according to the width of fixture

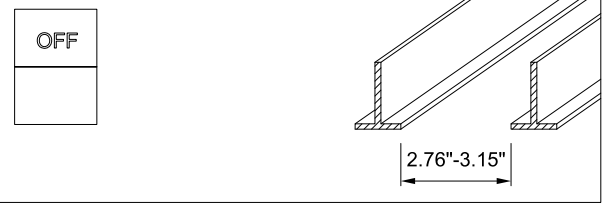


2.Hang the safe steel rope

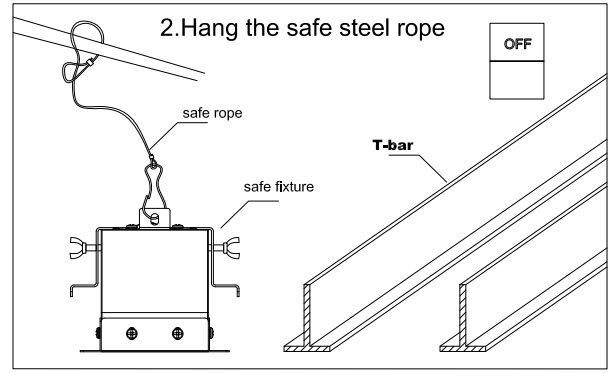


3. Adjust the safe cable according to the T-BAR, Lock screw tightly.

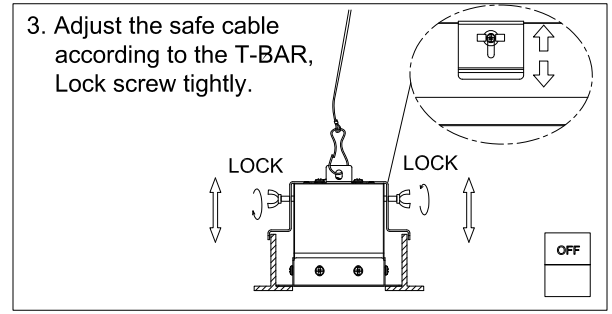

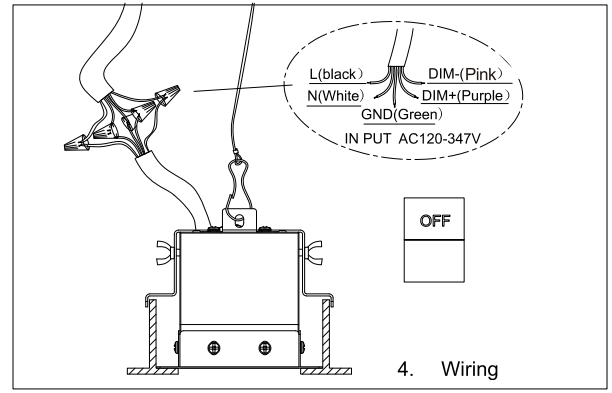

4. Wiring

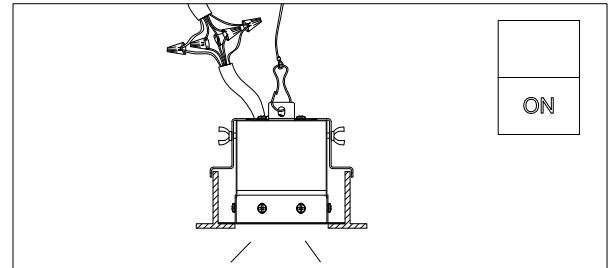

5.Make sure the wire connect is correct. Turn on the light


注：印刷时红色外框虚线与标注不印刷。

280 mm


210 mm

G. Frange Recessed Mount with Clips


1.Open the hole according to the size of the light, and pull out the AC wire.

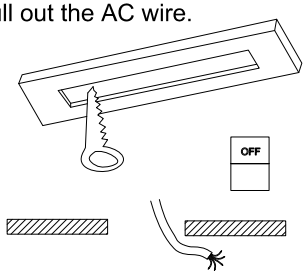


2.Pull up the spring clamp and fix with rope (Adjust the size according to hole size)

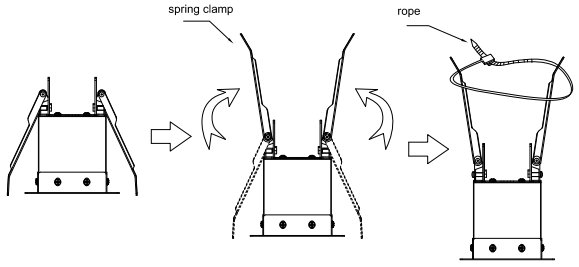


3.Remove the rope

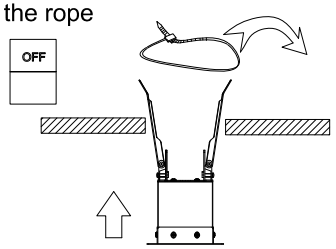


4.See the blew drawing,wire with connector.

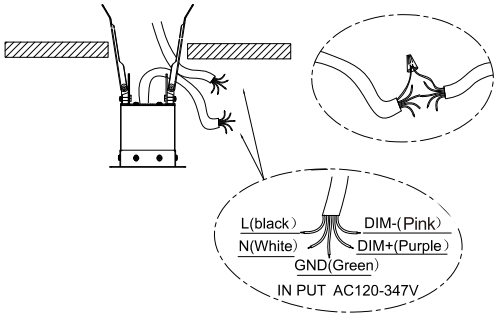

5.After finish wire, put the whole light into the hole.

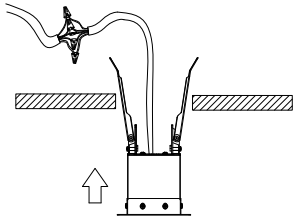

6.Done, turn on the light.

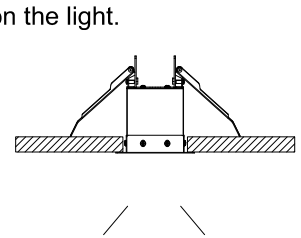


H. Function

B-Series

CCT Changeable:

Note: Only available for CCT changeable products.

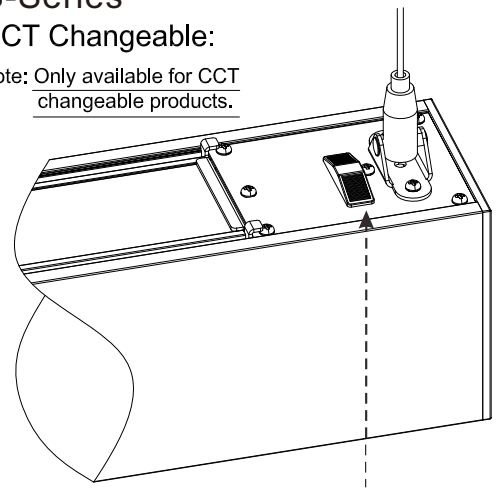

	Change CCT
1	
2	A
3	A+B
	B

C-Series

Switch A+B)


A-Down on

B-Up on

	A&B change		
1	1	A	A= Down Light
2	2	A+B	B= Up Light
3	3	B	

CCT Changeable:

Note: Only available for CCT changeable products.

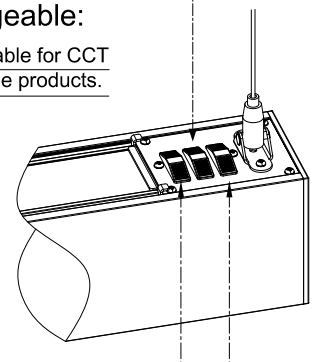


	Pattern	Down Light	Up Light	
1		A	B	A= Down Light
2	1	xx k	xx k	
3	2	xy k	xy k	B= Up Light
	3	yy k	yy k	

注：印刷时红色外框虚线与标注不印刷。

280 mm
210 mm


I · E-Series

Up and down luminescence change

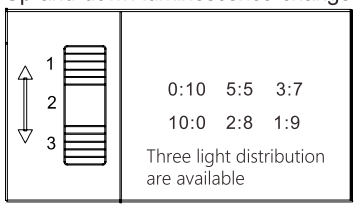



CCT Changeable:

Note: Only available for CCT changeable products.

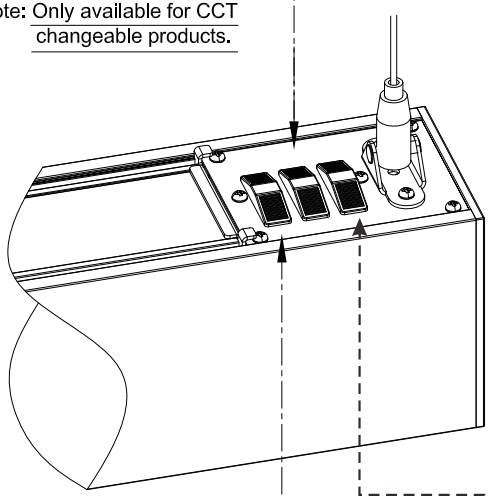


Power Change

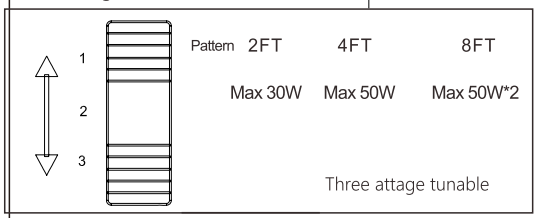

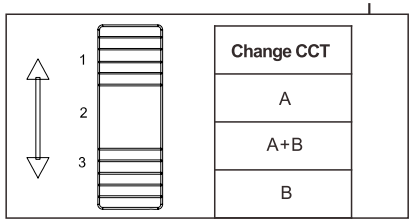


J. Install The Sensor


1. Take off the end cap.

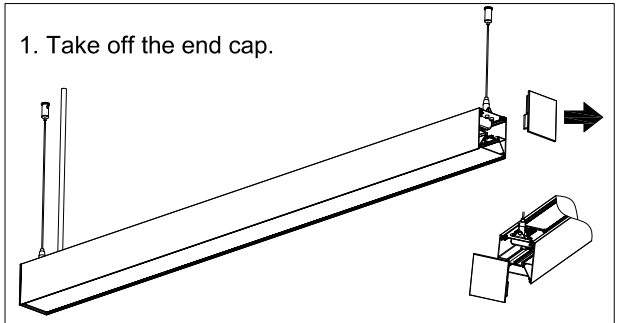

2. Take out the PC lens, and cut off 25mm(0.98")

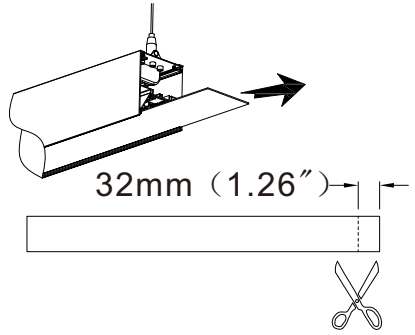


3. Install the MICROWAVE sensor according to below steps.

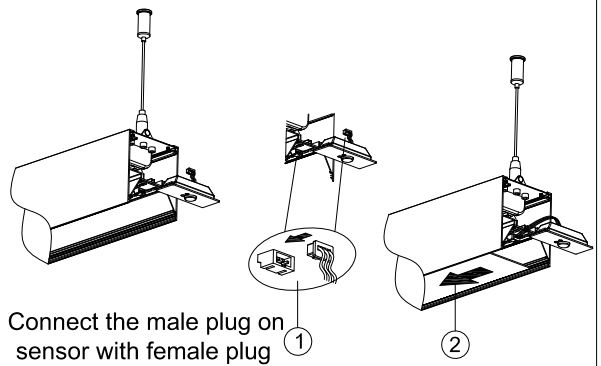


Connect the male plug on sensor with female plug on the PCB board

Put the PC lens on the fixture

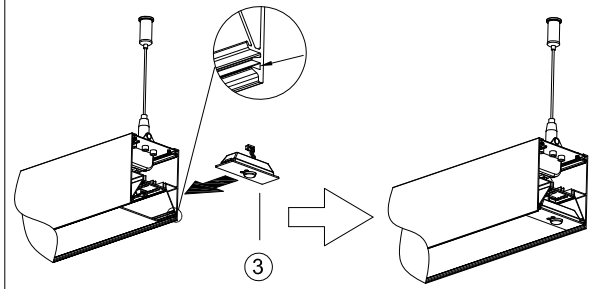


Install the sensor on the fixture as the PC lens.

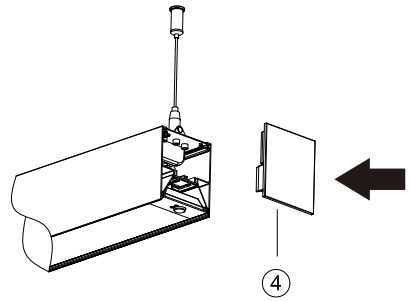

Put on the end cap

4. Turn on the light, set the Sensor according to the requirement.

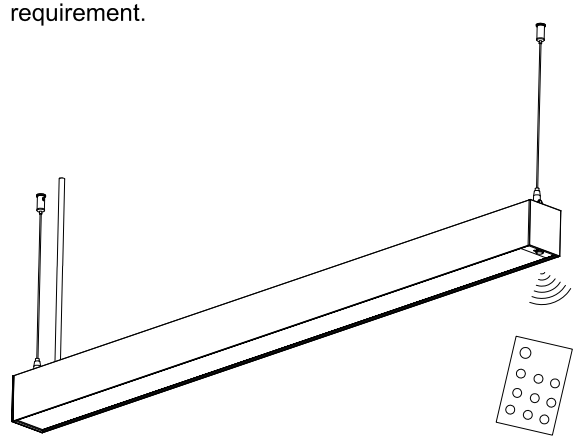


注：印刷时红色外框虚线与标注不印刷。

280 mm


210 mm

K. Change PC Lens with Parabolic Lens


1. Take off the end cap.

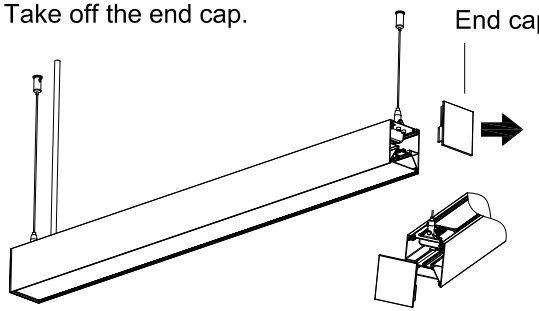


2. Take out the PC lens.

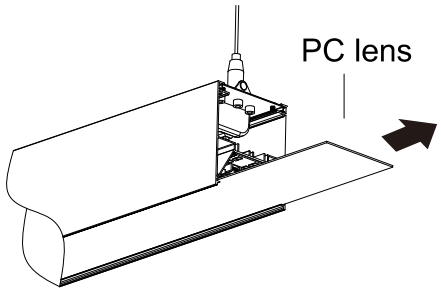


3. Mount the parabolic lens on(by the same groove of PC Lens)

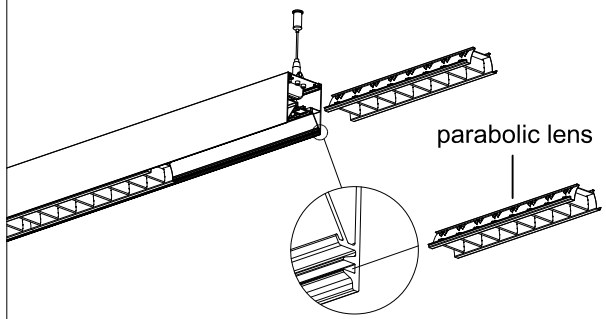

3. Put on the End Cap.

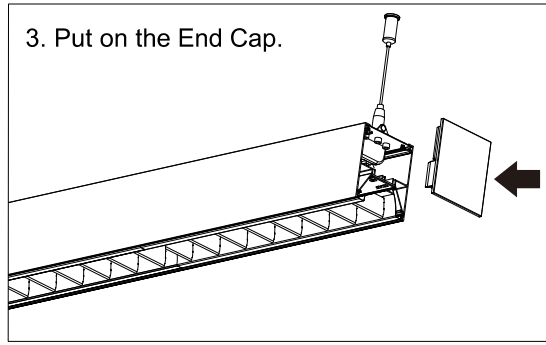


4. Done.

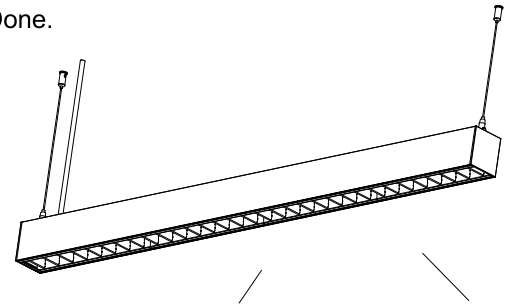


L. Link Pattern

1. Pattern Suspend Mount as a Separate Part.


L- Shape Pattern

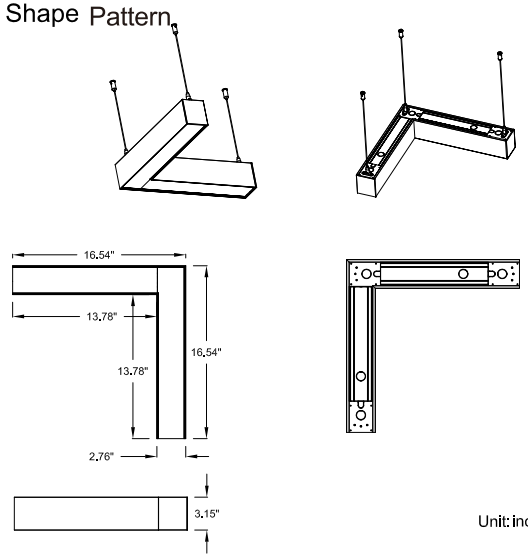

T - Shape Pattern

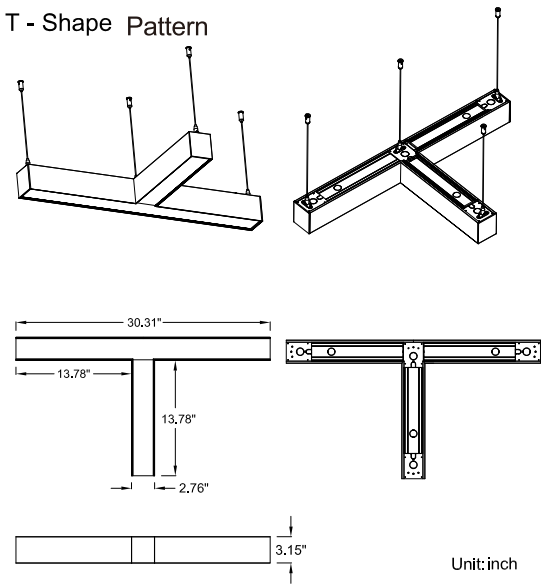

X- Shape Pattern

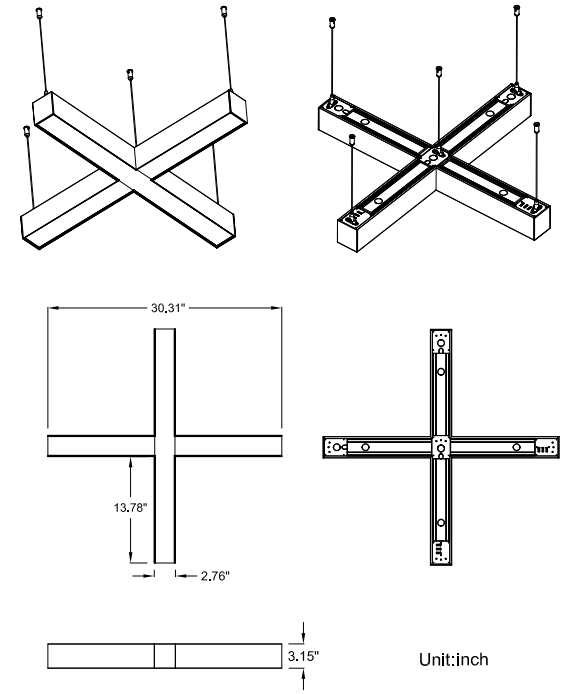


注：印刷时红色外框虚线与标注不印刷。

280 mm


210 mm

2. Pattern Suspended Mount as Link Part.


L- Shape Pattern

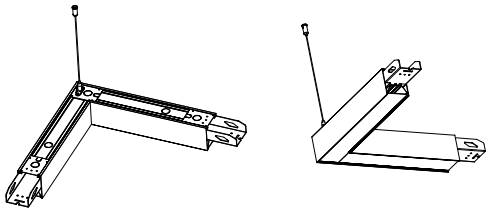

T - Shape Pattern

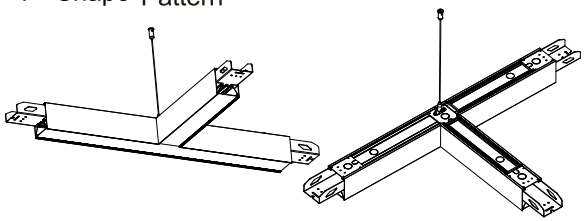

X- Shape Pattern

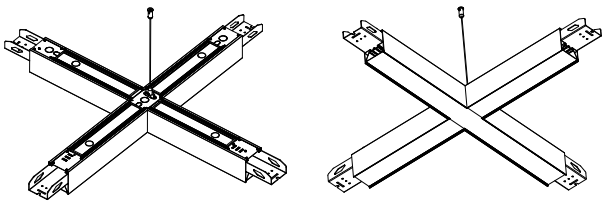

Linkable fixtures Qty need to meet the below two conditions:


1) N≤7pcs

2) Input voltage = 120V , N*P≤420W

Input voltage = 277V , N*P≤960W

Input voltage = 347V, N*P≤1200W


Note: N = Qty of linkable fixtures,
P = Wattage per fixture

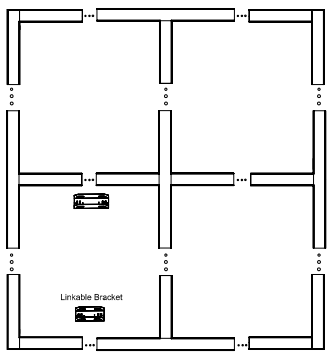


This splicing diagram requires more than two AC inlet wiring points.

M. Drop Ceiling Suspension Moumt

Mountincoming

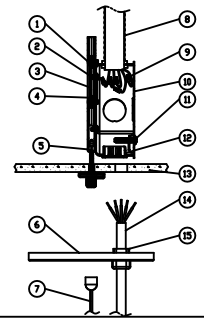

lineNon-incoming line

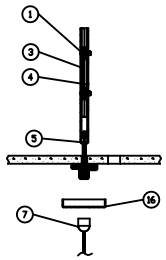

list

1.M4*8MM screws x4PCS

2.M4*5MM screws x2PCS

3.T-GRID bracket x2PCS

4.T-GRID fixed bracket x2PCS

5.T-GRID(other provided)

6.5-inch canopy x2PCS

7.Aircraft cable (other provided)

8.Armored Cable & Connector (other provided)

9.Wire Nut (other provided)

10.Junction box x1PCS

11.8#-32*1-3/4 screws x6PCS


12.Plastic Grommet x1PCS


13.Ceiling Tile(other provided)


14.AC power cord (other provided)


15.Cable tie x2PCS


16.1.7inch canopy x1PCS



1.M4*8MM screws



2.M4*5MM screws



3.T-GRID bracket



4.T-GRID fixed bracket



6.5-inch canopy


10.Junction box


11.8#-32*1-3/4 screws



12.Plastic Grommet


15.Cable tie



16.1.7inch canopy

N. SDS:Drywall Suspension Kits

incoming line

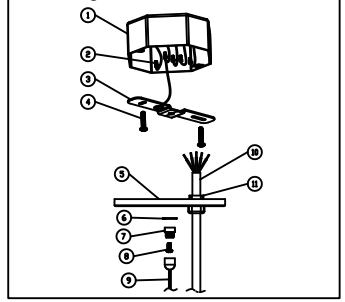

Non-incoming line

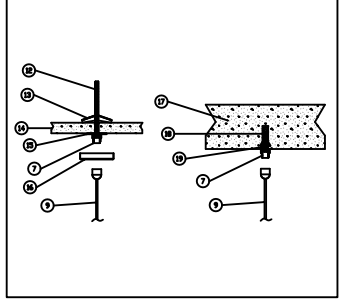

list

1. Junction box (other provided);

2. Wire Nut (other provided);

3. I-bracket x1PCS

4.8#-32*1-3/4 screws x4PCS

5.5-inch canopy x2PCS

6.M4 inner and outer serrated gaskets x1PCS

7. Secure the head x2PCS

8.M4*10mm screws x2PCS

9. Aircraft cable (other provided)

10. AC power cord (other provided)

11. Cable tie x1PCS

12.M4*70mm screws x2PCS

13.M4 aircraft expansion screws x2PCS

14.Drywall Ceiling (other provided)


15.M4 flat gasket x2PCS


16.1.7inch canopy x1PCS


17.Solid Ceiling (other provided)


18. Plastic Grommet x4PCS


19.PA4*30mm screws x4PCS



3. I-bracket



4. 8#-32*1-3/4 screws


5. 5-inch canopy



6.M4 inner and outer serrated gaskets



7.Secure the head



8.M4*10mm screws



11.Cable tie


12.M4*70mm screws


13.M4 aircraft expansion screws


15.M4 flat gasket


16.1.7inch canopy


18. Plastic Grommet



19.PA4*30mm screws

注：印刷时红色外框虚线与标注不印刷。

280 mm


210 mm


O. Drywall Suspenion mount (Type-B)

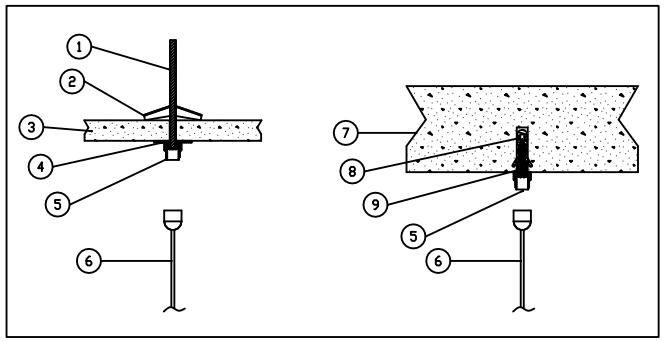



list


1.M4*70mm screws; x2PCS
2.M4 aircraft expansion screws; x2PCS
3.Drywall Ceiling (other provided)
4.M4 flat gasket x2PCS
5. Secure the head x2PCS
6. Aircraft cable x2PCS
7.Solid Ceiling (other provided)
8. rubber plug x2PCS
9.PA4*30mm screws x2PCS



1.M4*70mm screws;



2.M4 aircraft expansion screws;


4.M4 flat gasket


5. Secure the head



6. Aircraft cable


8. rubber plug


9.PA4*30mm screws


P. Metal non-luminous L/T/X Connector Installation Instruction

BOM for L shape connector

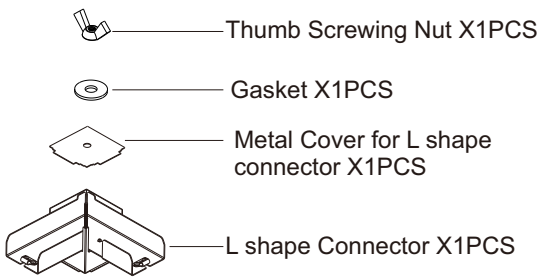


10


BOM for T shape connector

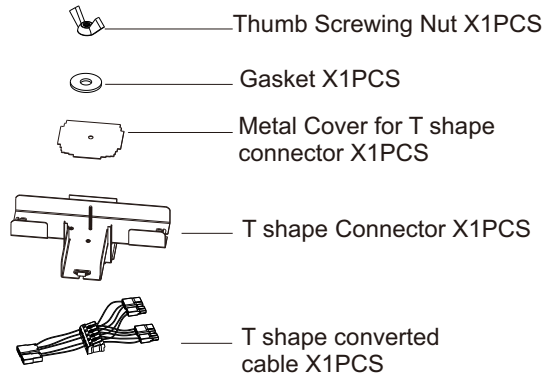

BOM for X shape connector

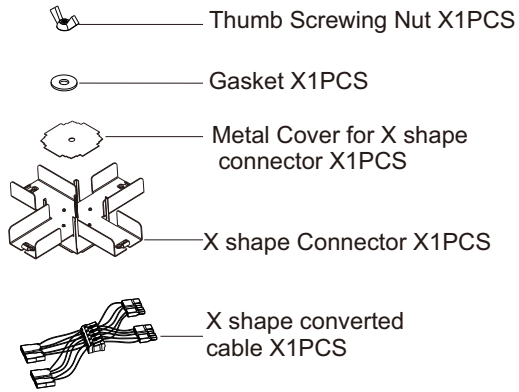


Splicing diagram

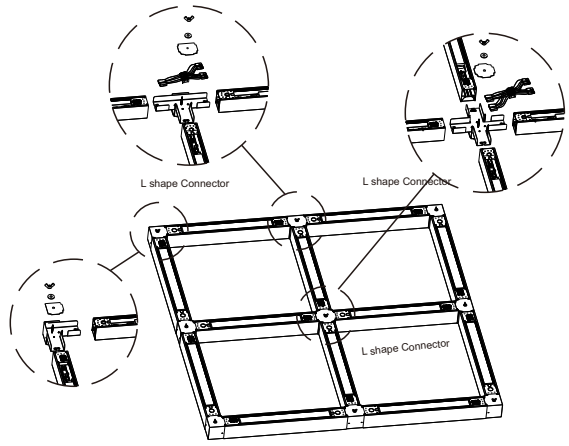


Q. Louver Installation Instruction

Bill of Materials

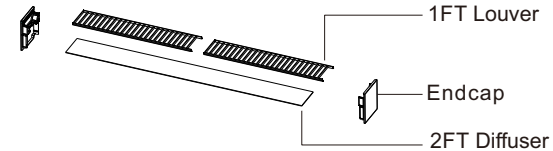


Bill of Materials			
Product Model	2FT Diffuser (pcs)	1FT Louver (pcs)	Endcap (pcs)
2FT	1	2	2
4FT	2	4	2
6FT	3	6	2
8FT	4	8	2

1

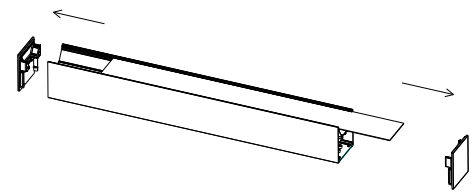


1.Remove the endcaps from two ends.
2.Remove the diffuser

2

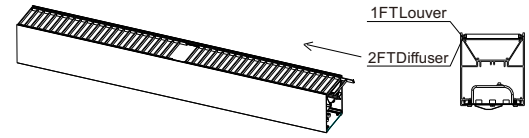

1.Put the 2ft diffuser into one slot on the extrusion.
2.Put the 1ft louver into another slot on the extrusion.

3

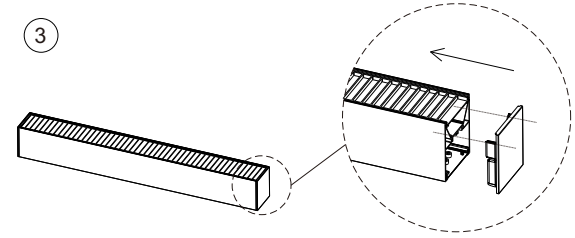


Put two endcaps into the ends of the extrusion

注：印刷时红色外框虚线与标注不印刷。

280 mm
210 mm

R. Dry Ceiling Wall Recessed

1

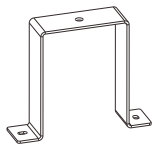

T-BAR bracket x 2pcs



Fix plate x 2pcs



PA4*30mm Screw x 4pcs




Rubber stopper x 4pcs



Wing nut x 2pcs

PM4*8mm Screw x 4pcs

2

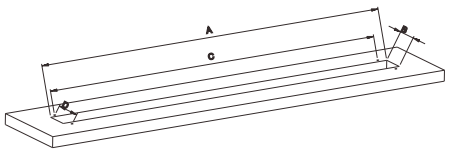


OFF

Suggest hole size						
No.	Modle	Fixture size (MM)	A(MM)	B(MM)	C(MM)	D(MM)
1	2FT	606*70*80	608	72	564	98
2	4FT	1206*70*80	1208	72	1164	98
3	6FT	1806*70*80	1808	72	1764	98
4	8FT	2406*70*80	2408	72	2364	98

Drill holes according to the size of the lamp


3

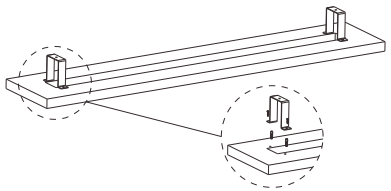

OFF

1.Rubber stopper embedded in the profile
2. Fix the T-BAR bracket with PA4*30 screws


4

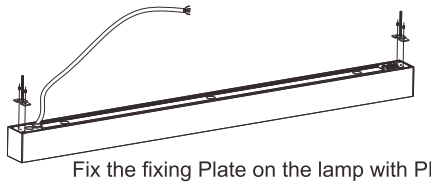

OFF

Fix the fixing Plate on the lamp with PM4*8 screws


5

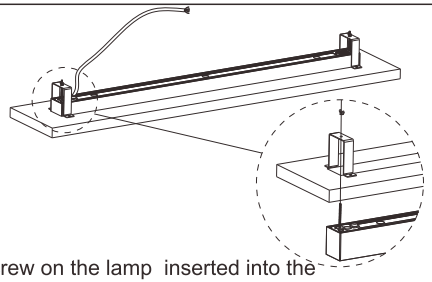

OFF

The screw on the lamp inserted into the
T-BAR bracket and fixed with M5 wing nut


6

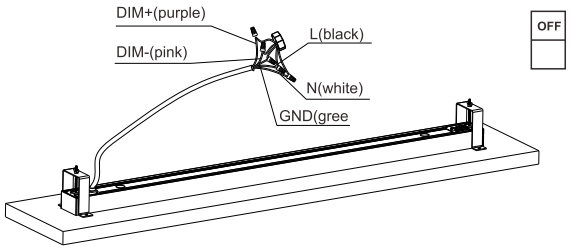

OFF

The dimming positive pole of the lamp is connected to the positive pole of the dimmer, and the dimming negative pole of the lamp is connected to the negative pole of the dimmer.
The L pole of the lamp is connected to the L pole of the mains, the N pole of the lamp is connected to the N pole of the mains, and the ground wire of the lamp is also connected to the ground wire of the mains.

7

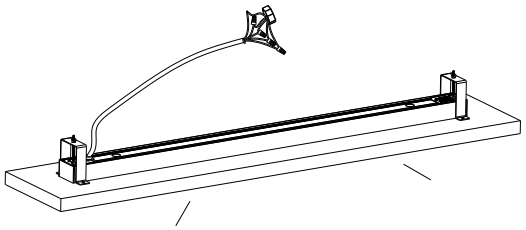


ON


The installation is complete and lights up.

S. New T-bar recessed

1



T-GRID bar x 2pcs




Fix plate x 2pcs



Wing nut x 2pcs

PM4*8mm Screw x 4pcs


2

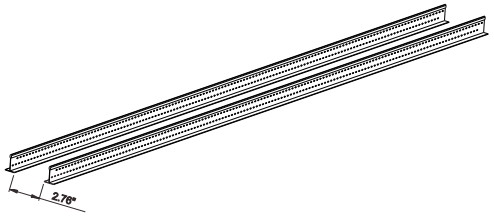

OFF

Adjust the position of T-bar according to the width of fixture


3

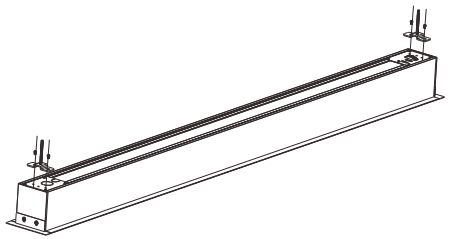

OFF

Fix the fixing Plate on the lamp with PM4*8 screws


4

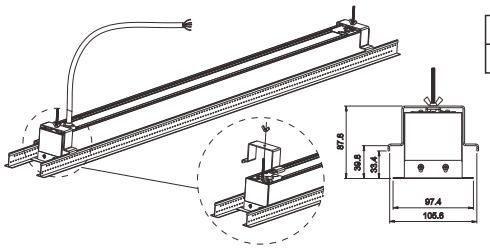

OFF

The screw on the lamp inserted into the
T-BAR bracket and fixed with M5 wing nut


5

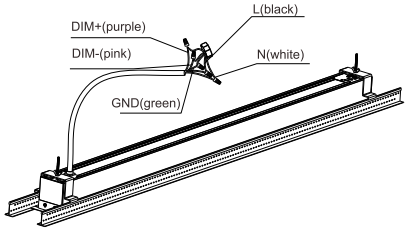

OFF

The positive pole of the lamp dimming is connected to the positive pole of the dimmer,
The negative pole of the lamp dimming is connected with the negative pole of the dimmer,
The L pole of the lamp is connected to the L pole of the mains,
The N pole of the lamp is connected to the N pole of the mains,
The ground wire of the lamp is also connected to the mains ground wire

6

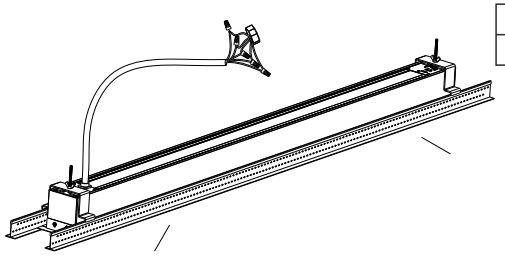


ON

The installation is complete and lights up

注　印刷时 红　外框　线与标注不印刷。


T. Install MAS & Sensor

①

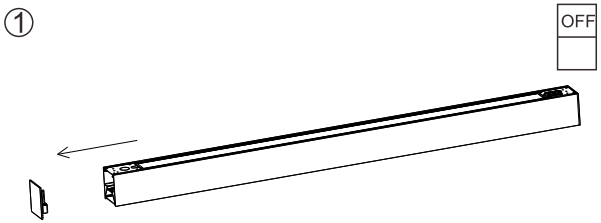


Remove the lamp input End Cap.

②

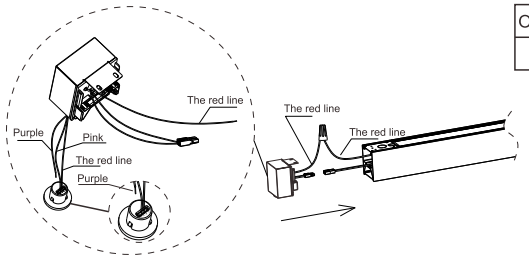


1. Insert the purple cable into 1# hole, pink cable for "-", red cable for "+";
2. Connect the male terminals to female from the lighting fixture;
3. Connect the red cable to red cable from lighting fixture with nipple connector;
4. Fix the sensor to MAS, and then fix the MAS to the lighting fixture by screws.

③

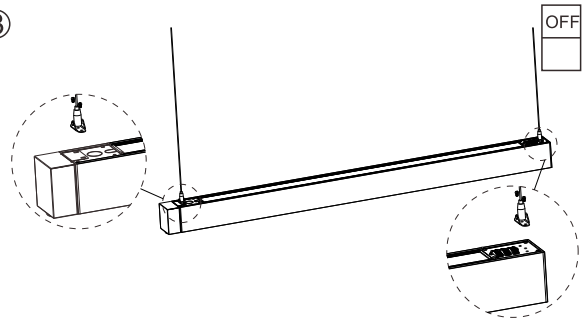

1. Fix the pedestal with Aircraft ropes to the lighting fixture by M4*8mm Screws;
2. Adjust the length of the suspending ropes, make balance of the lighting fixture.


④

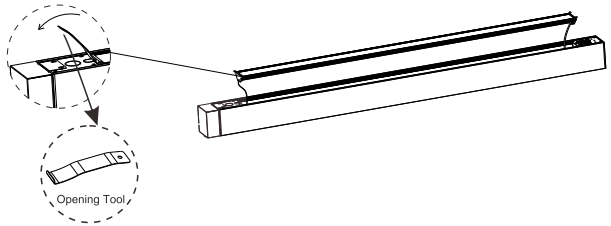

Take off the uppper modular by Opening Tool.




⑤

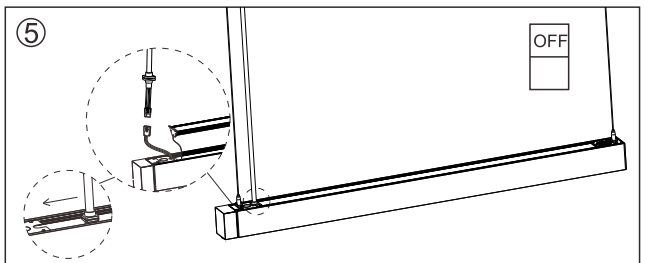

1. Connect the AC Input power cable to the lighting fixture: 3-wiring terminals, male to female.
2. Fix the AC input power cable to the stuckable hole on the lighting fixture.
3. Put the Upper Lighting modular back, and fix it to the lighting fixture.

⑥

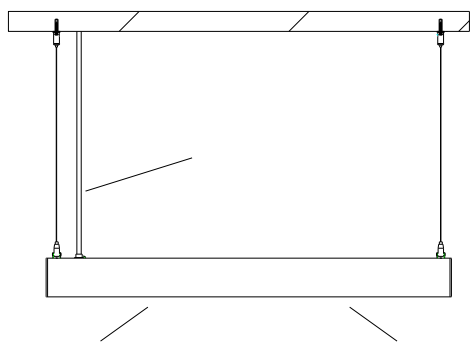

Turn On the Light and set the Sensor.

注　印刷时红　外框　线与标注不印刷。